



MATERIALS TESTING, INC.

55 LAURA STREET • NEW HAVEN, CONNECTICUT 06512 • (203) 468-5216
42 BOSTON POST ROAD • WILLIMANTIC, CONNECTICUT 06226 • (860) 423-1972

NVLAP #0320
Specific Scope Accredited

DATE: 03-11-11

REPORT: M-1005

CLIENT: McClure Construction Co.
61 Miner Road
Waterford, CT 06385


PROJECT: Client's Information

SUBJECT: SIEVE ANALYSIS (ASTM C-136)

Material: 1/2" Stone

Source: Groton Pit

Sampled by: and delivered by client to MTI on 3/8/11

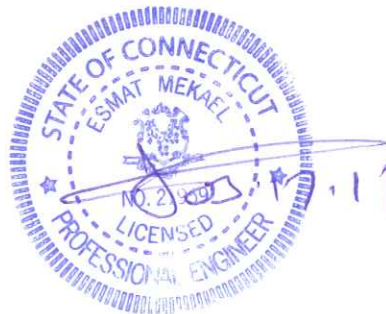

Sieve Size	Percent Passing	State of CT Dept. of Transportation Form 816 M.01.01 Size #67
1" (25mm)	100	100
3/4" (19mm)	100	90-100
1/2" (12.5mm)	79	
3/8" (9.5mm)	24	20-55
#4 (4.75mm)	4	0-10
#8 (2.36mm)	3	0-5

This material as sampled and delivered meets the listed specification.

Materials Testing, Inc.
Richard C. Kearns


William J. Soucy

1cc: Client

wlb



MATERIALS TESTING, INC.

55 LAURA STREET • NEW HAVEN, CONNECTICUT 06512 • (203) 468-5216
42 BOSTON POST ROAD • WILLIMANTIC, CONNECTICUT 06226 • (860) 423-1972

NVLAP #0320
Specific Scope Accredited

DATE: 03-11-11

REPORT: M-1006

CLIENT: McClure Construction Co.
61 Miner Road
Waterford, CT 06385

PROJECT: Client's Information

SUBJECT: SIEVE ANALYSIS (ASTM C-136)

Material: ¾" Stone

Source: McClure Pit, Groton, CT

Sampled by: and delivered by client to MTI on 3/8/11



Sieve Size	Percent Passing
1" (25mm)	100
¾" (19mm)	69
½" (12.5mm)	7
⅜" (9.5mm)	3
#4 (4.75mm)	1.5
#8 (2.36mm)	1.4

Materials Testing, Inc.
Richard C. Kearns


William J. Soucy

1cc: Client

wlb